

Date: Tuesday, 9/12/2006 1:11:09 PM
User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services
Job Number : 28462
Estimate Number : 12486
P.O. Number : N/A
This Issue : 9/12/2006 S.O. No. : N/A
Prsht Rev. : NC
First Issue : N/A Type : LANDING GEAR
Previous Run : 28471

Drawing Name : 350/355 AS X-TUBE AFT

Part Number : D350748201

Drawing Number : IIN-D350-748 PG5

Project Number : N/A

Drawing Revision : A UNDER REVIEW

Material : N/A

Due Date : 10/25/2006 **Qty:** 1 **Um:** Each

Written By : _____
Checked & Approved By : 06 09.12

Comment : Est Rev: A New Issue 06-07-05 JLM
Est Rev: B Update qty of MS21042L5 06-09-12 KJ

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0 DC DOCUMENT CONTROL



Comment: Photocopy bluefile & type labels per PPPD350-748-201 CHG001

06.10.11 KJ

2.0	28462A	X-TUBE AS 350/355 HI AFT
-----	--------	--------------------------



Comment: Sub-Component X-TUBE AS 350/355 HI AFT
D350-748-241 B 284624 ✓

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1
Pick Packing Kit

4.0	D35001	350 SADDLE
-----	--------	------------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)
350 SADDLE
Batch: B28794 ✓

5.0	D35011 <i>r</i>	BUSHING
-----	-----------------	---------



Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)
BUSHING
Batch: Ba 8127

PB 06/12/21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 9/12/2006 1:11:09 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 28462

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

AN46A #

Bolt



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Bolt

Batch: M102602 ✓

7.0

AN441A

bolt



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

bolt

Batch: M101538 ✓

8.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

Batch: ~~M102307~~ ⁰³ ~~M102307~~ ¹³ M14781 ✓

9.0

AN960JD416

Washer



Comment: Qty.: 32.0000 Each(s)/Unit Total : 32.0000 Each(s)

Washer

Batch: M102339 ✓

10.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Washer

Batch: M100564 ✓

11.0

MS21042L4

Nut



Comment: Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Nut

Batch: M19185 ✓

12.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Nut

Batch: M102171 ✓

⁰³ ~~M102171~~ Boe/12/21 ✓

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/01/02
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 9/12/2006 1:11:10 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 350/355 AS X-TUBE AFT

Job Number: 28462

Part Number: D350748201

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

LC 6/12/22 (1)

14.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-748-201

Location: _____

PPP Rev: *Draft*

LB 06/12/29 (1)

15.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

DOT 10/102 (1)
U 06/12/29

Job Completion



Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

3.10 Apply a continuous bead of Sikaflex-241/-291 or Proseal 890 or MIL-S-8802 Class B2 sealant in the following locations as per Figure 6:

- A) Along saddle/crosstube interface.
- B) Between the saddle flanges.
- C) Along saddle/skidtube interface.

4.0 WEIGHT AND BALANCE

The following weight and balance information is for Dart crosstube installations only. This data should be similar to the existing installation. Differences from the parts removed are the responsibility of the installer.

DART CROSSTUBE	FWD/AFT	WEIGHT	STA	MOMENT
D350-748-101	Fwd	35.2 lb (16.0 kg)	106.3 in (2.70 m)	3742 lb-in (43.2 kg-m)
D350-748-201	Aft	34.7 lb (15.7 kg)	162.4 in (4.12 m)	5635 lb-in (64.7 kg-m)

5.0 PARTS LIST

Qty -101	Qty -201	Part Number	Description
X		D350-748-101	CROSSTUBE INSTALLATION, AS 350/355 HIGH FWD
	X	D350-748-201	CROSSTUBE INSTALLATION, AS 350/355 HIGH AFT
1		D350-748-141	CROSSTUBE ASSEMBLY, AS 350/355 HIGH FWD
	1	D350-748-241	CROSSTUBE ASSEMBLY, AS 350/355 HIGH AFT
*2	*2	D3502-1	SUPPORT
*2	*2	D2856-400-710	ABRASION STRIP
*1	*1	AELS-1032-225	INSERT
*2	*2	MS21920-20	CLAMP
*1	*1	MS27039-1-10	SCREW
*1	*1	AN960JD10	WASHER
4	4	D3500-1	SADDLE
16	16	D3501-1	BUSHING
16	16	AN4-6A	BOLT
8	8	AN4-41A	BOLT
4	4	AN5-32A	BOLT
32	32	AN960JD416	WASHER
8	8	AN960JD516	WASHER
24	24	MS21042L4	NUT (OR MS21042-4)
4	4	MS21042L5	NUT (OR MS21042-5)

* REFERENCE ONLY. PARTS ARE INCLUDED IN D350-748-141/241 ASSEMBLIES ABOVE

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 28462

Date: Tuesday, 9/12/2006 1:11:27 PM
 User: Kim Johnston

Process Sheet

Customer:	: CU-DAR001 Dart Helicopters Services	Drawing Name:	: X-TUBE AS 350/355 HI AFT
Job Number:	: 28462A		
Estimate Number:	: 12483		
P.O. Number:	: N/A	Part Number:	: D350748241
This Issue:	: 9/12/2006	S.O. No.:	: N/A
Prsht Rev.:	: NC	Drawing Number:	: D350-748-241
First Issue:	: N/A	Project Number:	: N/A
Previous Run:	: 28471A	Drawing Revision:	: C UNDER REVIEW
	Type: LANDING GEAR	Material:	: N/A
Written By:	: <u>[Signature]</u>	Due Date:	: 10/25/2006
Checked & Approved By:	: <u>[Signature]</u>	Qty:	: 1 Um: Each
Comment:	: Est Rev: A New Issue 06-07-05 JLM : Est Rev: B Update cadplate process 06-09-12 KJ		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description:
---------	-----------------------	--------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D350-748-241 CHG001

2.0	D6018125	Crosstube Material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Crosstube Material

D6018-125

2.299" OD X 2.000" ID

Batch: 27432

BG 06-09-14

(2)

3.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs on both ends as per Folio FA647

2-Turn first side as per Folio FA647

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D350-748-241.

BG 06-09-15 1

4.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------







Comment: INSPECT ALL DIM TO DIM SHEET

BG 06-09-15 1

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: ☒ Date: 07/01/02
 QA: N/C Closed: _____ Date: _____

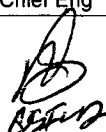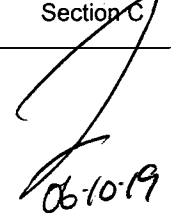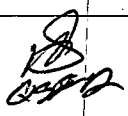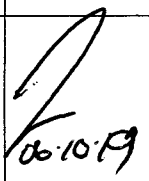NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
06-09-14	3	Tube cut to wrong length.		Tube replaced.	SG 06-09-14	 06-10-19		 06-10-19

NOTE: Date & initial all entries

Date: Tuesday, 9/12/2006 1:11:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 28462A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA647

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D350-748-241.

3-Scribe part # as per Dwg D350-748-241

BC 06-09-15

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

BC 06-09-15

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

5.6 06/09/14

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Remove all Machining Marks

pm '06-9-25

9.0

OUTSIDE SERVICE

OUTSIDE SERVICES



Comment: Sub-Contracting OUTSIDE SERVICES

Issue P/O: 2129

C 206/09/26

Heat Treat to min 180 KSI As per Dwg D350-748-241

Sand Blast tube after Heat Treat

Possible Supplier: Vac Aero

Ensure Certificate of Conformity is attached

10.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage

Ensure certificate of conformaty is attached

06/12/12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
06.12.20	15	MAGNETIC PARTICLES INSPECT PER DART QSI 038 4.2 Cadmium Plating PER AMS-QQ-P-4163 CLASS I TYPE II REF: D350748-141 Rev.D				CP 06.12.20 Per QSI 042	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 9/12/2006 1:11:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 28462A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

Joe 10-19 (1)

12.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Oil inside of tube with LPS-3.

A/R

LPS-3

Batch:

M101915

DP 6-11-14

13.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D350-748-241 using CNC bender program D350A and Folio FT

DP 6-10-25

14.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

Joe 11-13

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Remove all marks from tube within limits of D350-748-241

2-Drill Tube as per Dwg D350-748-241 Using DT8876 Drill Jigs,
Set-up drill table as per QSI 010

3-Deburr

4-Engrave Part # and Batch # as per Dwg D350-748-241

Joe 06-11-14 (1)

POSITIVE
RECALL

DP 6-11-14

16.0

OUTSIDE SERVICE

OUTSIDE SERVICES



Comment: Sub-Contracting OUTSIDE SERVICES

Issue P/O: *2501*

Stress relief at 375° for 5 hours

Magnetic Particle Inspect per ASTM E1444

Cadium Plate per QQ-P-416F, Class 1, Type 2

Embrittle relief at 375° for 8 hours, Chromate Treat

Possible Supplier: Southwest United Industries

Ensure Certificate of Conformity is attached

C 20611115 (1)

Joe 12/2/06 (1)

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 9/12/2006 1:11:27 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 28462A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

17.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage


Ensure certificate of conformity is attached

06/12/20

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

06-12-20

19.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside crosstube as per QSI 005 4.2

ml 06 12 20

(7)

2-Paint Outside of Tube as per Dart QSI 005 4.2

ml 06 12 20

(1)

20.0

QC14

Inspect Spray Paint



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

06-12-21

21.0

D35021

SUPPORT



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

SUPPORT

Batch:

B28089

RT 06-12-21

22.0

D2856400

Abrasion Strip



Comment: Qty.: 1.2401 f(s)/Unit Total: 1.2401 f(s)

Abrasion Strip 7.10" long x2

Batch:

B28258

RT 06-12-21

23.0

ALS41032225

Insert



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Insert

Batch:

M19393

RT 06-12-21

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 9/12/2006 1:11:28 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 28462A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

AN960JD10

Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Washer

Batch: 100743

RT 06-12-21

25.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Clamp (per MIL-DTL-8783C)

Batch: M102440

RT 06-12-21

26.0

MS27039110

Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Screw

Batch: 618836

RT 06-12-21

27.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install Ground wire Insert, then insert screw and washer

2-Install Abrasion strips as per Dwg D350-748-241 & QSI 035.

3-Install supports Using Dt8876 as per Dwg D350-748-241, Torque to 60-80 IN-LBS

RT 06-12-21

28.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

1006/12/22 ①

29.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D350-748-241

Location: _____


PPP Rev: _____

W/A

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector
06/12/22	28.1	Use Lps 3 inside of crosstube M 101915					M 06/12/22

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____



QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 9/12/2006 1:11:28 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT

Job Number: 28462A

Part Number: D350748241

Job Number:



Seq. #:

Machine Or Operation:

Description :

30.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

①
SD 07/10/102

Job Completion



POSITIVE RECALL

EFFECTIVE 06.09.13 AUTH U

RELEASED U DATE 06.12.20

U 06.12.29

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN <i>qp</i>	DRAWN BY <i>qp</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>#</i>	APPROVED <i>#</i>	DRAWING NO. D350-748-241	REV. C SHEET 1 OF 3
DATE 06.08.14		TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE NTS
A	06.03.31	NEW ISSUE	
B	06.06.30	ADD D6018-125 & PRIME AND PAINT	
C	06.08.14	ADD CAD PLATING	

UNDER REVIEW*qp* 06.08.14CAD PLATING PROCEDURE
WAS CHANGED

QTY	P/N	DESCRIPTION
X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
1	D6018-125	CROSSTUBE (OR D6015-125)
2	D3502-1	SUPPORT
2	D2856-400-710	ABRASION STRIP
1	AELS-1032-225	INSERT
1	AN960JD10	WASHER
2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
1	MS27039-1-10	SCREW


D350-748-141 CROSSTUBE:

- 1) MATERIAL: MANUFACTURED FROM D6018-125 OR D6015-125
FINISHED LENGTH = 122.70 ± 0.06
- 2) MACHINE PER MACHINING DETAIL ON PAGE 3. BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITIONS SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 3) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 4) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 5) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS 2759-1C AFTER TURNING
- 6) FINISH: CADMIUM PLATE PER QQ-P-416F, CLASS 1, TYPE II
MAGNETIC PARTICLE INSPECT PER ASTM E1444 AFTER CADMIUM PLATING
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 7) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.
- 8) INSTALL D2856-400-710 ABRASION STRIP WITH A GAP ON BOTTOM SIDE OF CROSSTUBE CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 9) TORQUE MS21920-20 CLAMPS 60 TO 80 IN-LB
- 10) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 11) ALL DIMENSIONS ARE IN INCHES
- 12) PART IS SYMMETRIC ABOUT CENTERLINE EXCEPT FOR $\varnothing 0.297$ HOLE.

RELEASED06.08.15 *#*


Copyright © 2006 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

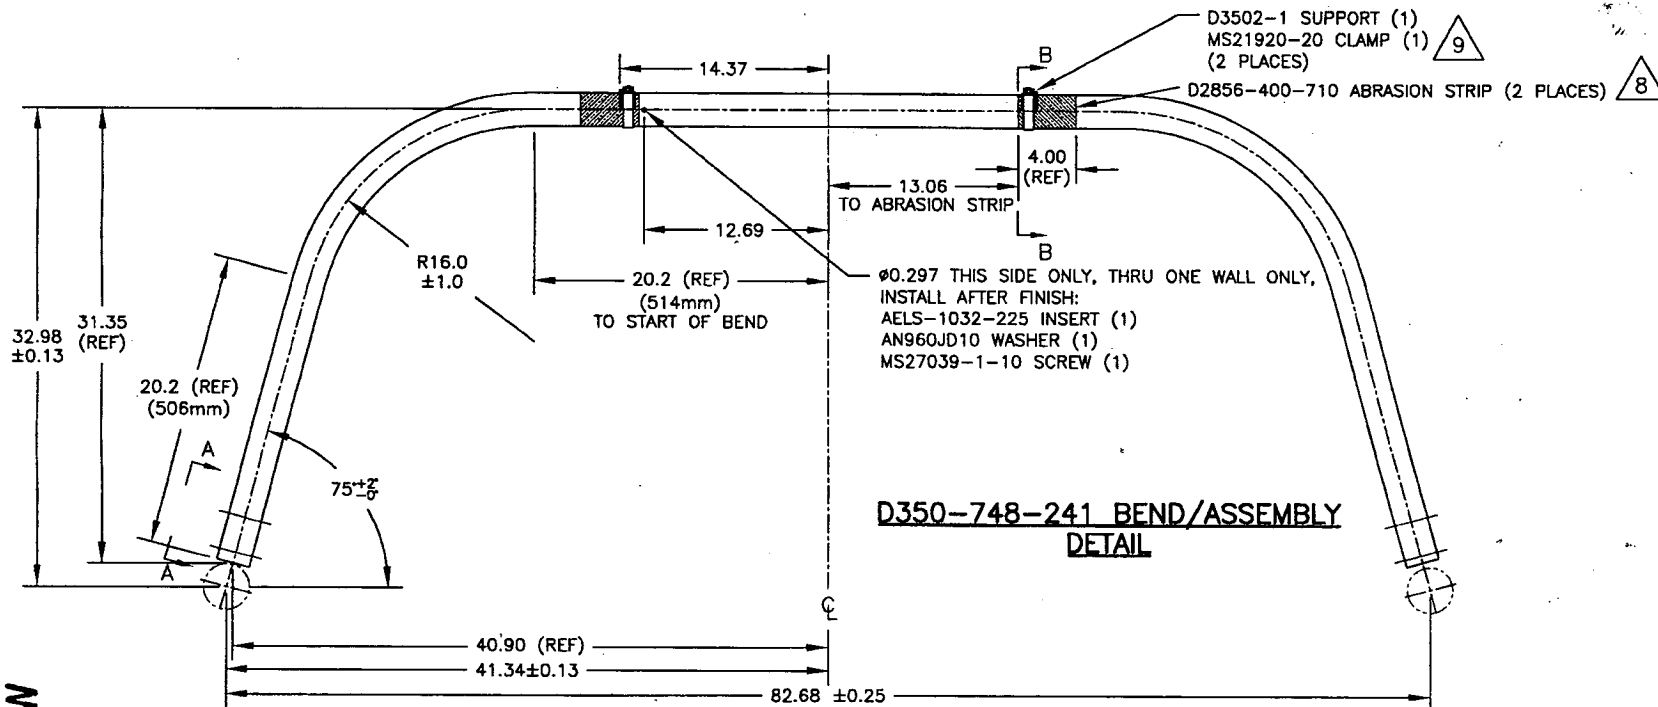


D350-748-241 BEND/ASSEMBLY DETAIL

SECTION B-B SCALE 1:2

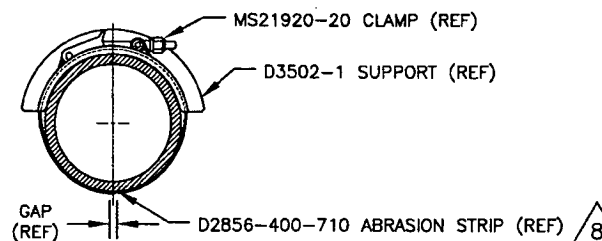

RELEASED

06-08-15

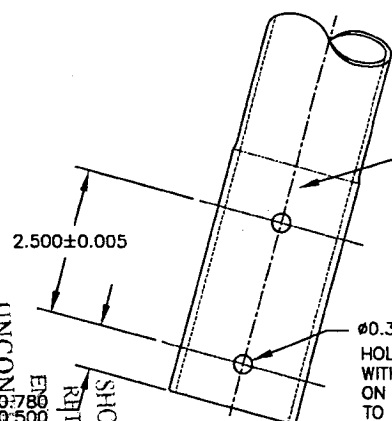

VIEW A-A SCALE 1:2


UNDER REVIEW

NO 08462A
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2008 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	q	DRAWN BY	q	DART	DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA
CHECKED	#	APPROVED	#	DRAWING NO.	D350-748-241
DATE	06.08.14	TITLE	CROSSTUBE (AS 350/355 HI AFT)	REV. C	SHEET 2 OF 3
		SCALE	1:8		

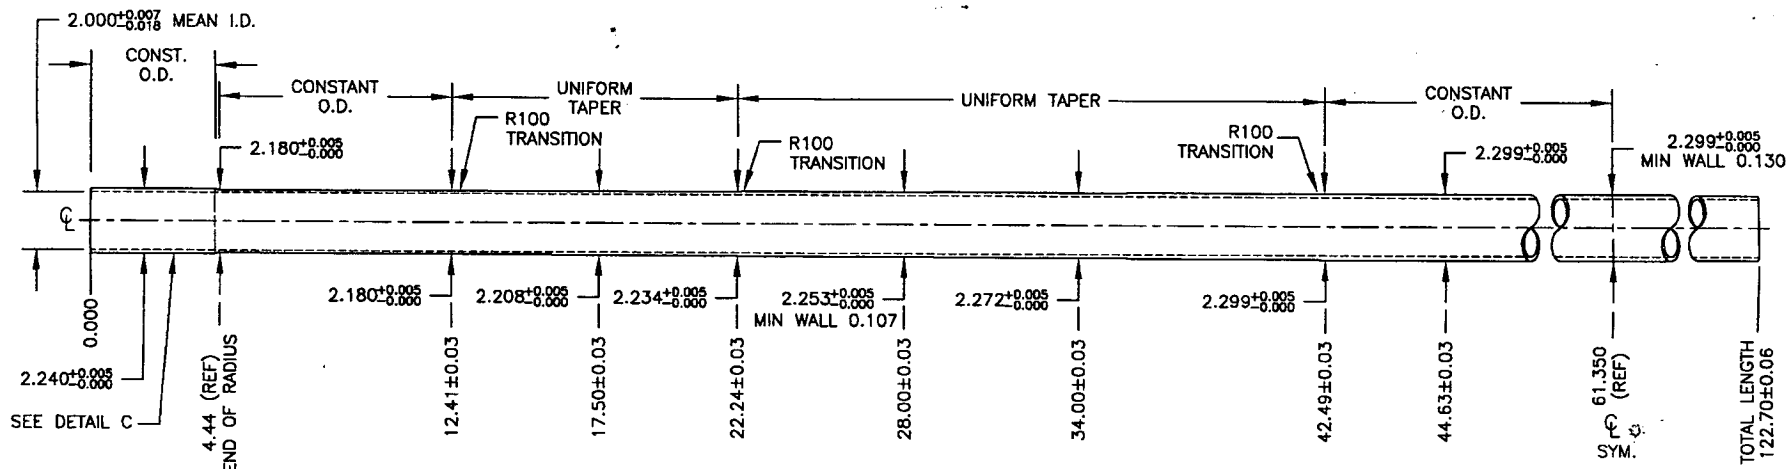



D350-748-241 MACHINING DETAIL

RELEASED

06.08.15

UNDER REVIEW

DETAIL C: CUFF
SCALE 1:1

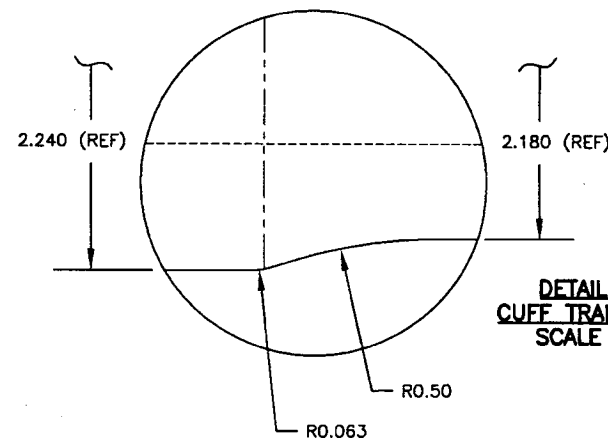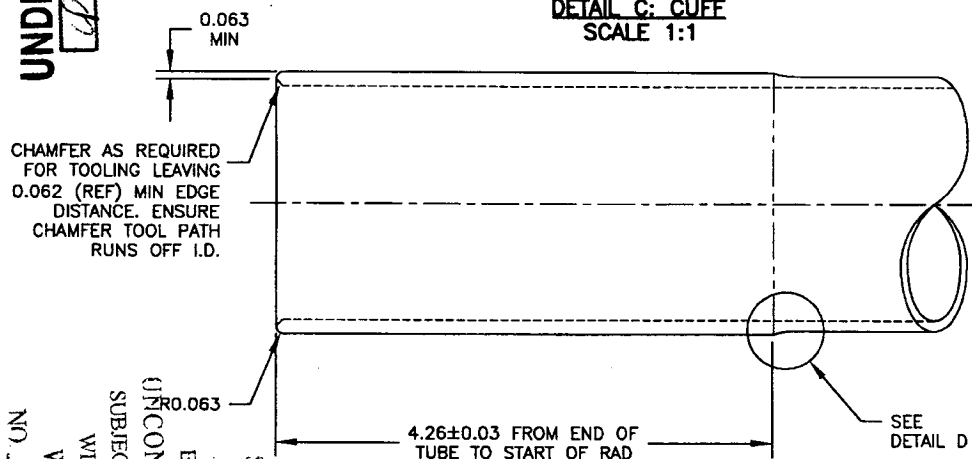

DETAIL D:
CUFF TRANSITION
SCALE 9:1

NO. 28462 A

WORK ORDER

SUBJECT TO AMENDMENT WITHOUT NOTICE

UNCONTROLLED COPY

ENGINEERING

RETURN TO

SHOP COPY

COPYRIGHT © 2008 BY DART AEROSPACE LTD.		DESIGN	90	DRAWN BY	90	DART DART AEROSPACE LTD. MARKHAM, ONTARIO, CANADA	REV. C
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	A	APPROVED	A		
DATE		06.08.14		DRAWING NO.		D350-748-241	SHEET 3 OF 3
TITLE		CROSSTUBE (AS 350/355 HI. AFT)		SCALE		1:4	

DART AEROSPACE LTD		Work Order:
Description: 350 X-TUBE		Part Number: 0350-748-241
Inspection Dwg: 350-748-241 Rev: C		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☒ Prototype

Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
2.240	$\pm .005$ $-.000$	2.243	/			
2.180	"	2.185	/			
2.180	"	2.185	/			
2.208	"	2.213	/			
2.234	"	2.237	/			
2.253	"	2.255	/			
2.272	"	2.276	/			
2.299	"	2.303	/			
4.26	$\pm .030$	4.26	/			
.063	$\pm .010$.063	/			
122.7	$\pm .06$	122.7	/			
2.240	$\pm .005$ $-.000$	2.244	/			
2.180	"	2.185	/			
2.180	"	2.185	/			
2.208	"	2.213	/			
2.234	"	2.237	/			
2.253	"	2.256	/			
2.272	"	2.276	/			
2.299	"	2.303	/			
4.26	$\pm .03$	4.26	/			
.063	$\pm .010$.063	/			

Measured by: <i>EC</i>	Audited by: <i>J.G</i>	Prototype Approval:
Date: 06-09-15	Date: 06/09/19	Date:

Rev	Date	Change	Revised by	Approved
A		New Issue	KJ/JLM	

110 D350-748-201



VAC AERO

INTERNATIONAL INC.

RELEASE NOTE

GST No.: R105468102

OAK 79915-1



HEAD OFFICE
1371 SPEERS ROAD, OAKVILLE, ONTARIO
CANADA L6L 2X5
TEL: (905) 827-4171 FAX: (905) 827-7489



2009 WYECROFT ROAD, UNIT B
OAKVILLE, ONTARIO
CANADA L6L 6J4
TEL: (905) 827-7377 FAX: (905) 827-1380



QUEBEC DIVISION
7450 RUE VERITE STREET, ST. LAURENT, QUEBEC
CANADA H4S 1C5
TEL: (514) 334-4240 FAX: (514) 334-6269

10/11/2006

MM/DD/YYYY

PAGE: 1

BILL TO: 1DAR01
DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

SHIP TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

K6A 1K7

K6A 1K7

DATE SHIPPED	SHIP VIA	F.O.B.
10/11/2006		ORIGIN
CUSTOMER P/O No.	JOB No.	TERMS
PO00002129		COD

PART No.	DESCRIPTION	UOM	QTY ORD	QTY SHPD	TEST RESULTS
D350-CROSS TUBES		EA	10	10	
<p>Process Specifications: Procedure: 4353 HEAT TREATED TO 180-200 KSI PER AMS 2759-1C 100% HARDNESS TESTED PER ASTM E-18 HRC 40-43 MATERIAL: 4130</p> <p>5 PCS. P/N: D350748141 B28452, B28460, B28458, B28466, B28461 5 PCS. P/N: D350748241 B28462, B28464, B28465, B28463, B28471</p> <p>SANDBLASTED AFTER HEAT TREAT</p> <p>28462</p>					
<div><div>100% HARDNESS TESTED 10 PCS. 42/43 HRC</div><div>VAL. Q.C. TH. 25</div></div>					

I hereby certify that the material covered by this release note has been inspected and tested and conforms to all specifications relevant thereto in accordance with the conditions of the contract / or purchase order.

ON BEHALF OF VAC AERO INTERNATIONAL INC.

Laura Freeman
Authorized Q.C. Inspector




HEAT
TREATING



VACUUM BRAZING - HEAT TREATING - SPECIAL PROCESSING - FURNACE EQUIPMENT

5-14-25

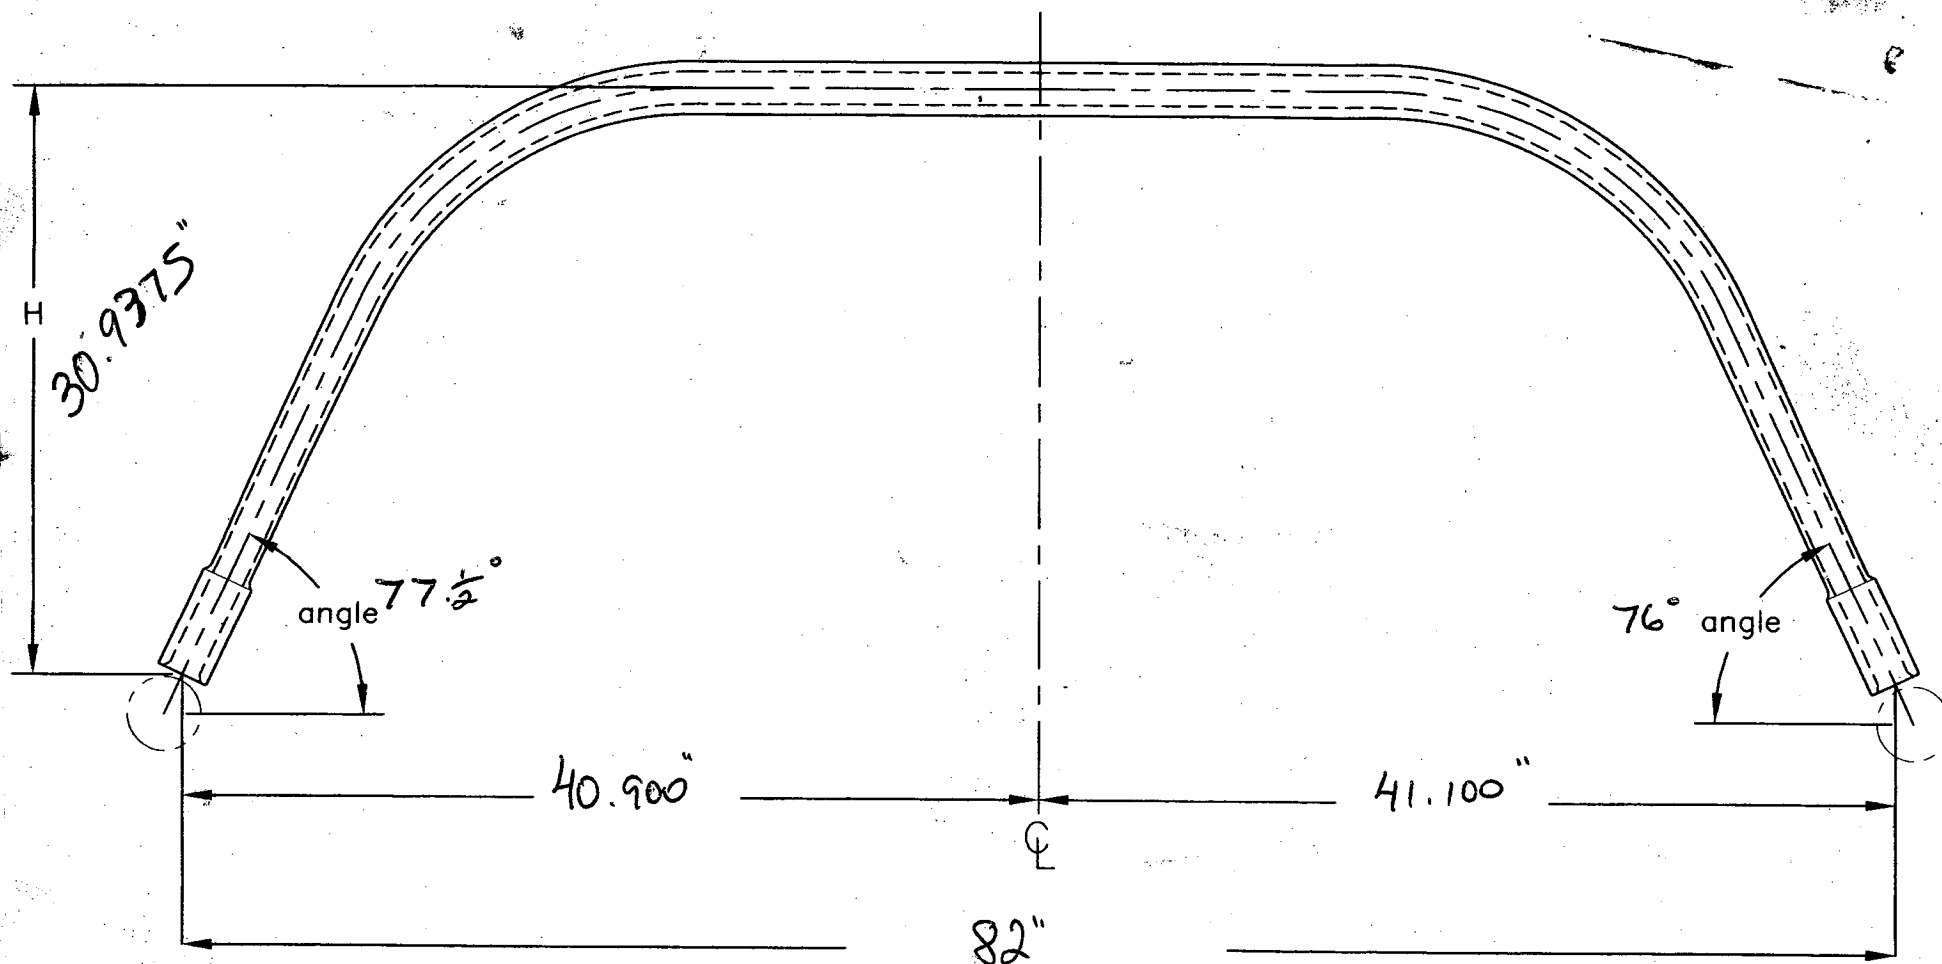

DATE: 06/11/06
 DESCRIPTION: A350748241
 BATCH NO: B28462A
 DRAWING: A350748241 Rev C under rev.
 H: 31.35"
 1/2 SPAN: 40.90"
 TOTAL SPAN: 81.8"
 ANGLE: 75°

[Signature]
 06-11-13



Southwest United Industries, Inc.

SOUTHWEST UNITED INDUSTRIES, INC.
422 S. St. Louis Tulsa, OK 74120

Page 1 of 1

PACKING LIST

DART AEROSPACE LTD
1270 ABERDEEN STREET
HAWKESBURY, ON K6A 1K7

Ship Date: 12/18/2006

QTY		Part Number/Description	
Certification #: 14450		Certification Date: 12/18/2006	
1.00	D350-748-141	Ref-No: B28458A	
	CROSSTUBE	Job-No: 32000	
		P/O #: 274731	
1.00	D350-748-141	Ref-No: B28460A	
	CROSSTUBE	Job-No: 32014	
		P/O #: 274731	
1.00	D350-748-141	Ref-No: B28466A	
	CROSSTUBE	Job-No: 32015	
		P/O #: 274731	
1.00	D350-748-141	Ref-No: B28462A	
	CROSSTUBE	Job-No: 32016	
		P/O #: 274731	
1.00	D350-748-141	Ref-No: B28463A	
	CROSSTUBE	Job-No: 32017	
		P/O #: 274731	
1.00	D350-748-141	Ref-No: B28465A	
	CROSSTUBE	Job-No: 32018	
		P/O #: 274731	
JOB QTY FOR 14450:		6	SHIPPED QTY FOR 14450: 6

Tracking #: k

Ship Via: OTHERS

COD Amount: \$ 1,980.00

FAA Repair Station CN2R748K

Subject to Southwest United Industries, Inc. Standard Terms and Conditions available for review at www.swunited.com



Southwest United Industries, Inc.

SOUTHWEST UNITED INDUSTRIES, INC.
422 S. St. Louis Tulsa, OK 74120

Page 1 of 2

CERTIFICATION

DART AEROSPACE LTD
1270 ABERDEEN STREET
HAWKESBURY, ON K6A 1K7
CANADA

Certification #: 14450

Certification Date: 12/18/2006

Qty	Part Number/Description	Job-No/Order-No/Ctl-No
1	D350-748-141 CROSSTUBE	32000 274731 B28458A
1	D350-748-141 CROSSTUBE	32014 274731 B28460A
1	D350-748-141 CROSSTUBE	32015 274731 B28466A
1	D350-748-141 CROSSTUBE	32016 274731 B28462A
1	D350-748-141 CROSSTUBE	32017 274731 B28463A
1	D350-748-141 CROSSTUBE	32018 274731 B28465A

1. Stress relieve at 350-400F for 4 hours minimum

2. Cadmium plate per AMS-QQ-P-416B, Type II, ☒
Class 1 (QQ-P-416, Type II, Class 1)

3. Embrittlement relieve within 4 hours of plating
at 350-400F for 8 hours minimum

4. Magnetic particle inspect per ASTM E 1444-05. ☒
No linear indications/cracks allowed.

Qty Ins: 6 Qty Rej: 0 Qty Acc: 6

5. Inspect

FAA Repair Station CN2R748K

Subject to Southwest United Industries, Inc. Standard Terms and Conditions available for review at www.swunited.com



Southwest United Industries, Inc.

SOUTHWEST UNITED INDUSTRIES, INC.
422 S. St. Louis Tulsa, OK 74120

Page 2 of 2

CERTIFICATION

We certify that the parts listed above have been processed in accordance with the requirements and specifications of the above referenced purchase order. Documentation is on file and available for review.

Certification By: 

WISE, ROBERT



FAA Repair Station CN2R748K

Subject to Southwest United Industries, Inc. Standard Terms and Conditions available for review at www.swunited.com

